

ZF3 SSR SERIES

POWER CONTROLS

The ZF3 SCR Series are three-phase (3 or 4 wire), zero-fired SCR Power Controls designed to deliver maximum power control with all of the features normally found in much larger units. Utilizing only two frame sizes, these units are conservatively engineered for years of trouble free service while providing the benefits of precise, reliable control of for your electronic process.

The ZF3 SSR Series accepts all standard voltage and current command signals or remote potentiometer input. Standard operating voltages are 120, 240, 400, 480 & 575 Vac, 3 Phase, 50/60Hz. Other voltages are available.

Multi-turn Zero and Span adjustments are provided for matching the SCR power control to the command signal. The command signal indicator's (green) flash rate is proportional to the output voltage.

Applications:

Primarily used to control static resistive or non-inductive 3 or 4 wire loads.

- Small electric furnaces
- Electric ovens, kilns & heaters
- Extrusion or injection molding

15-70 Amperes
Three-phase (3 or 4 Wire)
Zero-fired



- 5 year "No Hassle" warranty
- Electrically Isolated Heatsink
- Conservative Thermal Design
- Voltage Squared Linearity
- Transient voltage Protection (MOV)
- Soft Start
- Command Signal Indicator
- Multi-Turn Zero & Span Adjustments
- UL, cUL Listed, CE Compliant



100kA
SCCR



ISO
9001
 QUALITY
 ASSURANCE

AMETEK®
HDR POWER SYSTEMS

530 Lakeview Plaza Blvd Ste C
 Worthington, Ohio 43085
 Toll Free: 1-888-PWR-CNTR (797-2685)
 Phone: 614-308-5500
 Fax: 614-308-5506
www.hdrpower.com

SPECIFICATIONS:

Control Method: Zero-firing of back-to-back SCRs (3-leg Control)

Voltage Rating: 120, 240, 400, 480, 575 Vac

Line Frequency: 50 / 60 Hz

Current Ratings: 15, 25, 40, 70 Amperes

Command Signal: Most standard process signals

Adjustments: Zero and Span, multi-turn

Isolation: 2500 volts rms from power circuit to command signal and to ground

Ambient Temperature: Operating: 0 °C to 50 °C

Relative humidity: 0 to 95% (non-condensing)

HOW TO ORDER:

Make a selection from each of the tables below. Place the selection in the corresponding boxes to build your model.

ZF3 - - - -

| VOLTAGE* | | CURRENT | OPTIONS | | COMMAND | | |
|----------|----------------------------------|---------|---------------------------------|--------------------|---------------------------------|--------------------|------------------------------------|
| 120 Vac | <input type="text" value="120"/> | 15 A | <input type="text" value="15"/> | N.O. Thermostat | <input type="text" value="NO"/> | 4-20 mA | <input type="text" value="01"/> |
| 240 Vac | <input type="text" value="240"/> | 25 A | <input type="text" value="25"/> | N.C. Thermostat | <input type="text" value="NC"/> | 0-10 Vdc ◊ | <input type="text" value="02"/> |
| 400 Vac | <input type="text" value="400"/> | 40 A | <input type="text" value="40"/> | SCR Failure | <input type="text" value="SF"/> | 0-5 Vdc◊ | <input type="text" value="03"/> |
| 480 Vac | <input type="text" value="480"/> | 70 A | <input type="text" value="70"/> | Load Unbalance | <input type="text" value="UB"/> | Manual Pot Input^◊ | <input type="text" value="05"/> |
| 575 Vac | <input type="text" value="575"/> | | | Fuse Kit | <input type="text" value="FK"/> | Others | <input type="text" value="06-99"/> |
| | | | | 24 Vac Transformer | <input type="text" value="TX"/> | | |

* Other voltages available

Multiple options may be selected


^ Requires external potentiometer (5 k Ω)

◊ Requires 24 Vac Transformer

OUTLINES:

15 thru 40 A

Depth: 3.01 in
Weight: 3.6 lbs

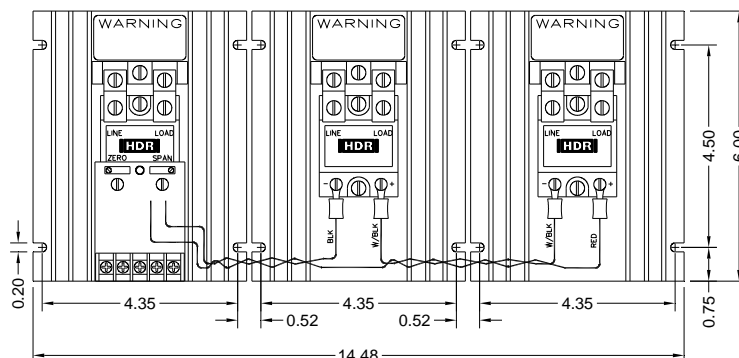

70 A

Depth: 5 in
Weight: 9 lbs

